


Bosch 0237.306.001 Advance Curve

Dist RPM	Low Side Adv	High Side Adv	Actual Advance
0	-1	1	0
250	-1	1	0
600	-1	1	0
700	-1	6	4
1000	3	8	6
1250	6	10	7
1500	7	11	8
1750	6.5	10.5	9
2000	6.25	10.25	8.5
2250	6	10	8
2500	7	11	9
2750	8	12	9.5
3000	9	12	10
3250	9	11.9	9.75
3500	9	11.6	9.5
3750	8.75	11.5	9.25
4000	8.5	11.4	9

Note Rpm and Advance Degrees are in Distributor Advance to get engine Advance Double the values

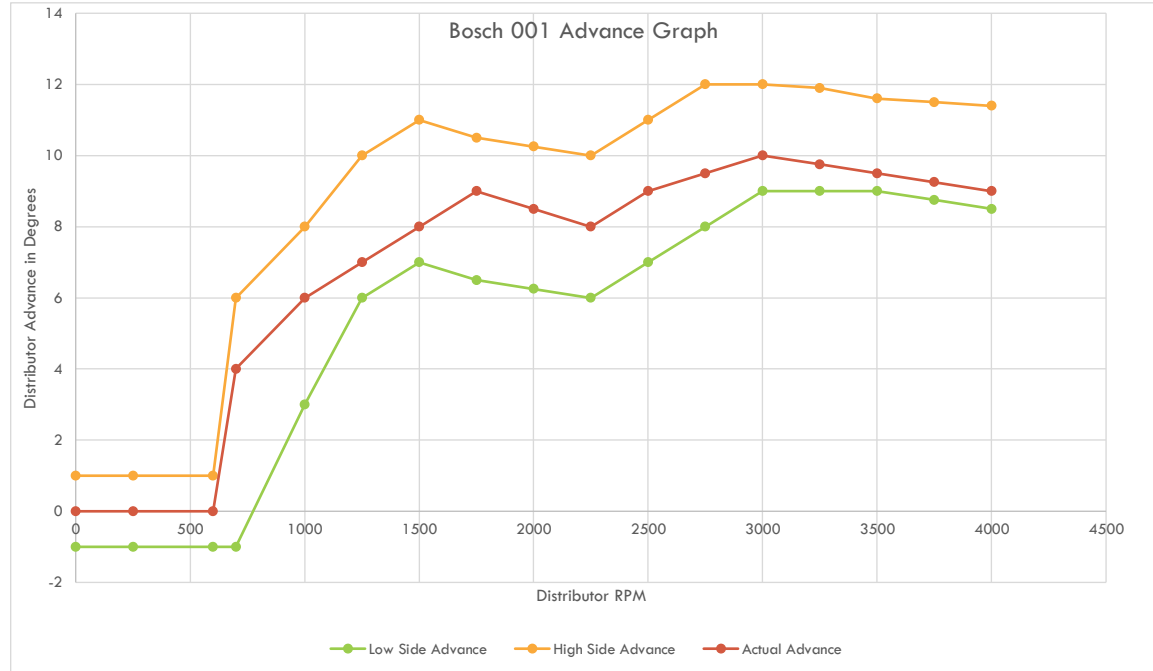

Vacuum Advance Operation

mBar Vacuum	Retard In Distributor Degrees
25	0
50	0
75	1
100	2
125	3
150	3
175	3
200	3
225	3
250	3
275	3
300	3

